


Greenspeed® & Extreme Units Fault Code 69 or 77 Update

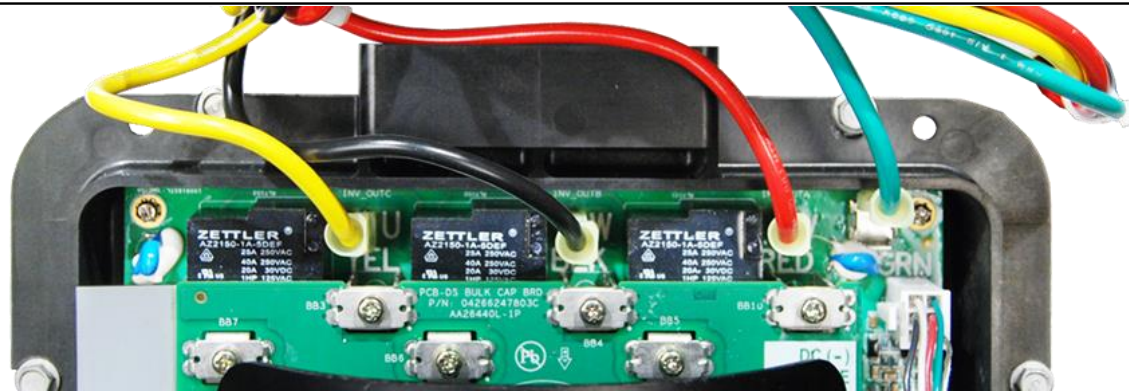

Issue description:

If a unit is reporting fault code 69 or 77 and a replacement inverter is experiencing the same. It may be a compressor issue and not an inverter.

Actions:

A troubleshooting suggestion would be to disconnect the four compressor output leads and attempt a system demand. If the unit faults out on the same fault codes, then the inverter has failed. If the unit faults out on a 79 – compressor no pump, then the inverter is good and the compressor has failed.